

SERVICE INFO



Important information on avoiding clutch pedal vibrations

Vehicle manufacturer: Audi, Seat, Skoda, VW

Models:

Audi: A3, Sportback, Quattro, Cabrio

Seat: Altea, Leon, Toledo, Ibiza

Skoda: Octavia, Superb, Fabia, Roomster

VW: Golf, Golf Plus, Jetta, Passat, Scirocco, Eos, Polo, Touran

Engine: 1.9 TDI

Engine codes: BKC, BLS, BXE

OE No.: 1K1 721 564 AP



Image 1: Hydraulic line with frequency modulator (anti-vibration unit)

From model year 2003, the vehicles listed above may experience vibrations on the clutch pedal when actuated.

In the event of a complaint, the cause can be attributed to the absence of or a faulty frequency modulator (anti-vibration unit), or to the fact that the electronic control unit software is not up to date.

The vibrations are generated as a result of axial torque deviations in the crankshaft, which are transferred to the pedal via the clutch hydraulics.

The frequency modulator suppresses pulsations in the system's hydraulic fluid, thereby preventing vibrations on the clutch pedal.

In most cases, this error is incorrectly attributed to a faulty clutch or to the dual mass flywheel.

Note:

Schaeffler Automotive Aftermarket therefore recommends the following test procedure:

- Is the electronic control unit software up to date?
- Is a frequency modulator fitted?

If necessary, the hydraulic line with frequency modulator should be replaced and subsequently refitted. The corresponding replacement parts are available from the vehicle manufacturer.

Any reference to replacement part numbers for vehicle manufacturers is for comparison purposes only.

Issued 02.2011

LuK 0024

Technical subject to change

© 2011 Schaeffler Automotive Aftermarket

For further information:

Phone: +44 (0) 14 32 264 264*

Fax: +44 (0) 14 32 375 760

Info@LuK-AS.co.uk

www.Schaeffler-Aftermarket.com

* Calls from within the UK 08457 001100

