

## 087923 and 087924 headlights remaining on after engine shutdown

Vehicle - Citroen C5 2000 – 2004 (all models)

A common fault with the above vehicle has been found, where the headlights remain on after the engine is shutdown. The cause appears to be a faulty body control unit (built-in systems interface – BSI). Water penetration into the control unit causes a short circuit and leads to the fore mentioned fault. Please note there is no problem with the headlight and the only way to rectify this issue is by replacing the control unit. The unit is located on the driver side, below the 16-pole diagnostic plug. Please be aware that after installation the control unit must be re-coded.

