


## The Problem

The Valeo warranty department have received a number of clutches returned for Peugeots and Citroens with BE type gearboxes with a fault of not engaging or difficulty in selecting gears.


After inspection of the returned parts, which have also included the release arm it can be seen there is wear in the release mechanism which will produce the symptoms mentioned.

When the clutch is replaced, the release mechanism will need to be checked and any parts replaced to eliminate the issue with the new clutch.

*Below are some examples of a worn release mechanism and what to look for.*

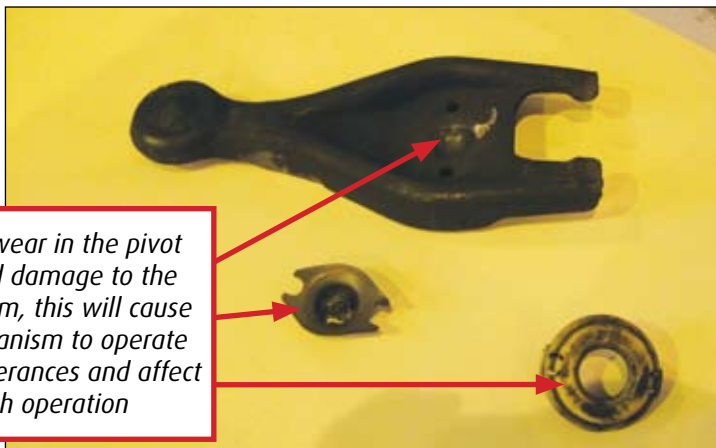

*There is wear in the pivot bush and damage to the release arm, this will cause the mechanism to operate outside tolerances and affect clutch operation*

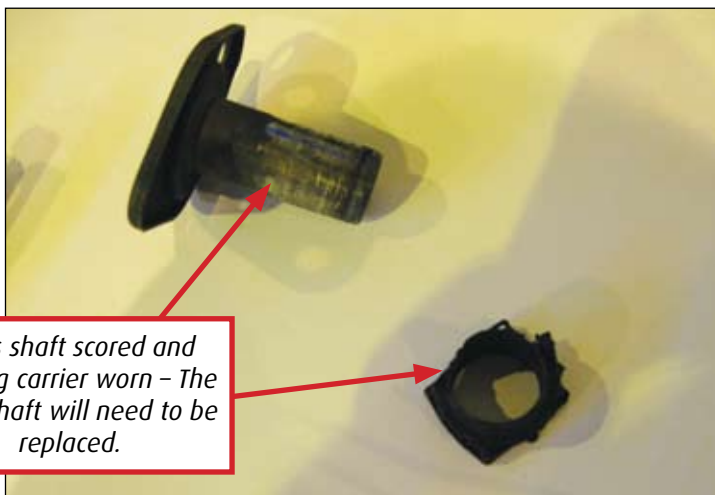

*Cross shaft scored and bearing carrier worn - The cross shaft will need to be replaced.*

**T.S.B. No.:**  
CL017/09

**PRODUCT:**  
Clutch

**MARQUE:**  
Peugeot, Citroen

**PART No.:**  
BE Type Gearbox

**SUBJECT:**  
Not engaging or  
difficulty in selecting  
gears

**DATE:**  
September 2009