


## New switch for power windows

### Background

The power window switch has a return spring. This is located behind the black switch button.

When the driver climbs down from the cab he may catch on the power window switch and the black button may be forced loose. The spring behind the plastic switch also falls out and is lost.

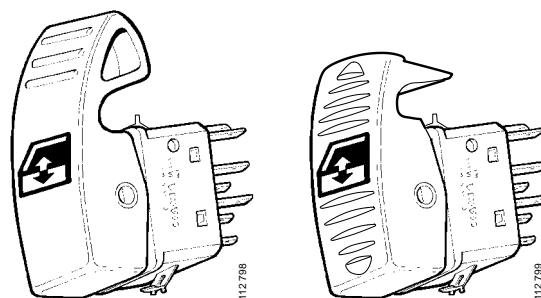

*Old switch.*

*New switch.*

### Production solution

In order to remedy this problem, a new shorter switch has been introduced into production from the following chassis numbers:

Scania Södertälje	1 243 941
Scania Zwolle	4 400 150
Scania Angers	9 036 062
Scania Latin America	

### Part

Designation	Outgoing part	New part
Switch	1 368 831	1 413 146

### Service solution

#### Work Description

- Remove:
  - the switch panel in the door
  - the electrical connector.
- Carefully press in the metal plates which secure the switch to the panel and remove the switch.
- Install
  - the new switch.
  - the electrical connector.
  - the panel in the door.