

New bulb in the roof sign illumination

Applicable to vehicles with roof sign illumination except CR19T.

Background

It has been reported that the roof sign illumination bulb has a short service life.

The existing bulb is replaced with a new standard bulb 21 W HD (Heavy duty).

Remedy

When replacing the old bulb with bulb 21 W HD (Heavy duty), the roof sign illumination reflector must also be replaced.

The new roof sign illumination has been introduced in production from the chassis numbers below:

Scania Södertälje	1 245 276
Scania Zwolle	4 402 275
Scania Angers	9 037 228
Scania Latin America	

Parts

Designation	Discontinued parts	New parts
Roof sign illumination assembly	1 384 124	1 427 227
Repair kit, contains reflector and bulb	-	1 428 394
Bulb 21 W HD	-	366 010

Service solution

Work Description

1. Disconnect the negative cable from the battery.
2. Open the roof sign illumination and disconnect the cables.
3. Remove the reflectors and the sheets for positive supply from the plastic retainers.

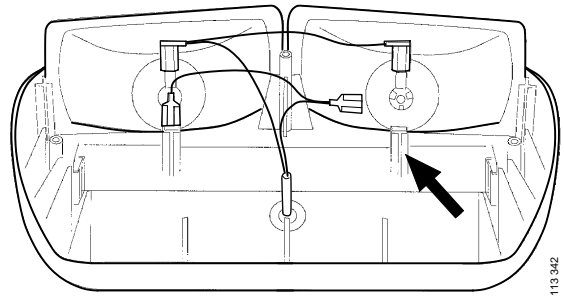


Fig. 1. The old reflectors.

Note: The plastic retainers must be removed in order to clear enough space for the new reflectors. See illustration 1. The easiest way to do this is with cutting pliers.

4. Fit the new reflectors with the new bulbs and connect the cables.
5. Reassemble the roof sign illumination.
6. Reconnect the negative cable to the battery.

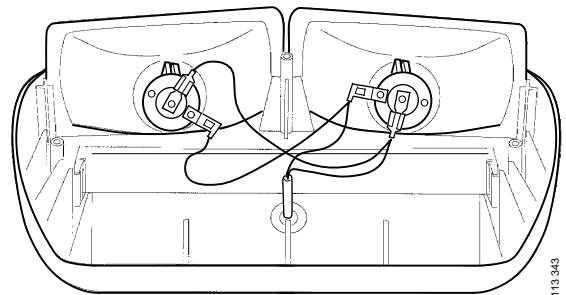


Fig. 2. The new reflectors.