


Water ingress into the wiring connectors

Part Number: 579756, 574281

For Vehicle: Renault Scenic Models

The Valeo Tech Care team have received several reports from garages stating the rear wiper system has failed and/or the rear window regulator and rear central locking.

After investigating the issues with local garages Valeo technicians have identified that the rear wiper system is not at fault and the issue is caused by water ingress into the wiring connectors under the sill along the driver's seat.

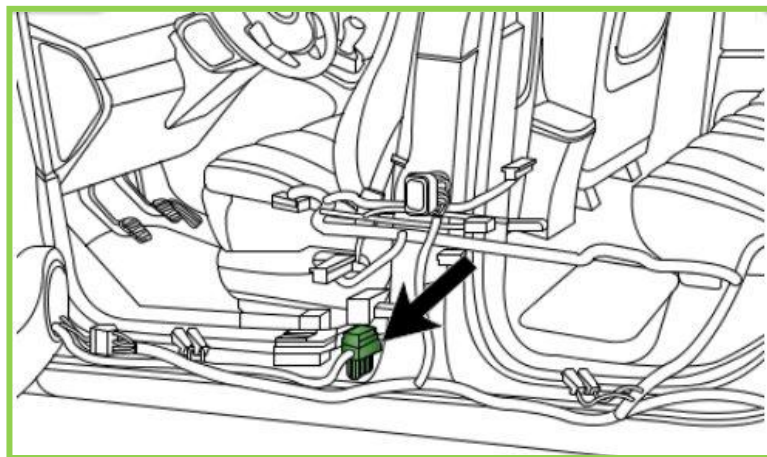

This water ingress is a result of the wiper compartment water drain becoming clogged.

As a result of the water ingress it is best practice to check connectors for corrosion and amend or renew the connector. Once performed the voltage to the window motor, wiper motor and central locking should be checked for correct operation.