## febi*tip*






## Need to check the oil level in a Mercedes-Benz 722.8 auto gearbox? No problem!

The oil level in an auto gearbox should be checked after an oil change or if there is a suspected leak. No dipstick is provided for the gearbox at the factory.

## febi bilstein has the solution! Dipstick for auto gearboxes 722.8

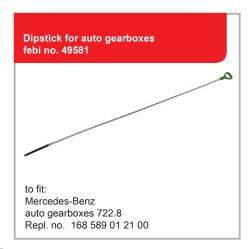

The filler tube is located in the engine compartment (Fig. 1).



The locking cap of the filler tube has a safety device to secure it against accidental opening) (Fig. 2).





Ferdinand Bilstein GmbH + Co. KG Wilhelmstr. 47 | 58256 Ennepetal | Germany

Tel. +49 2333 911-0 Fax +49 2333 911-444 E-Mail info@febi.com

Subject to technical changes









Use an appropriate tool to break off the disk of the locking pin before measuring the oil level (Fig. 2); remove the locking pin and take off the locking cap (Fig. 3).


When checking the oil level, insert the dipstick into the filler tube as far as it will go. As the length of the filler tube differs from model to model, part of the dipstick may protrude from the tube once it has reached the bottom (Fig. 4).

## Attention!



The oil dipstick has a graduated scale from 1 to 12. The oil level may be measured at both 50 °C (scale value 2 to 4) and also at 80 °C (scale value 5 to 7).

Be sure to remove the dipstick after measuring the oil level! The locking cap can be secured again with a new locking pin (febi 44204).

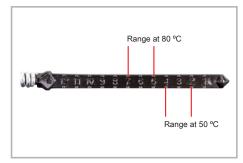



Register now for the official febi bilstein newsletter and receive the latest technical information automatically by email! Further information may be obtained at: www.febi.com

Simply ask for spare parts by febi bilstein. The complete range can be found at: www.febi-parts.com

Ferdinand Bilstein GmbH + Co. KG

Wilhelmstr. 47 | 58256 Ennepetal | Germany

Tel. +49 2333 911-0 Fax +49 2333 911-444 E-Mail info@febi.com

