



1 710 702

16:14-13

Utgåva/Issue/Ausgabe/Uitgave/Edición/Edition/Edizione/Painos 1

ETC med AC

ETC with A/C

ETC mit AC

ETC met AC

ETC con AC

ETC avec AC



ETC con AC

ETC com AC

ETC ja AC

ETC com AC

Fordon tillverkade efter 9804
Vehicles manufactured after 9804
Fahrzeug gebaut nach 9804
Na 0498 gefabriceerde voertuigen
Vehículos fabricados después de 9804
Véhicules fabriqués après 9804
Veicoli realizzati dopo il 04/98
Ennen 9804 valmistetut ajoneuvot
Veículos fabricados após 9804

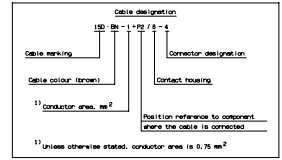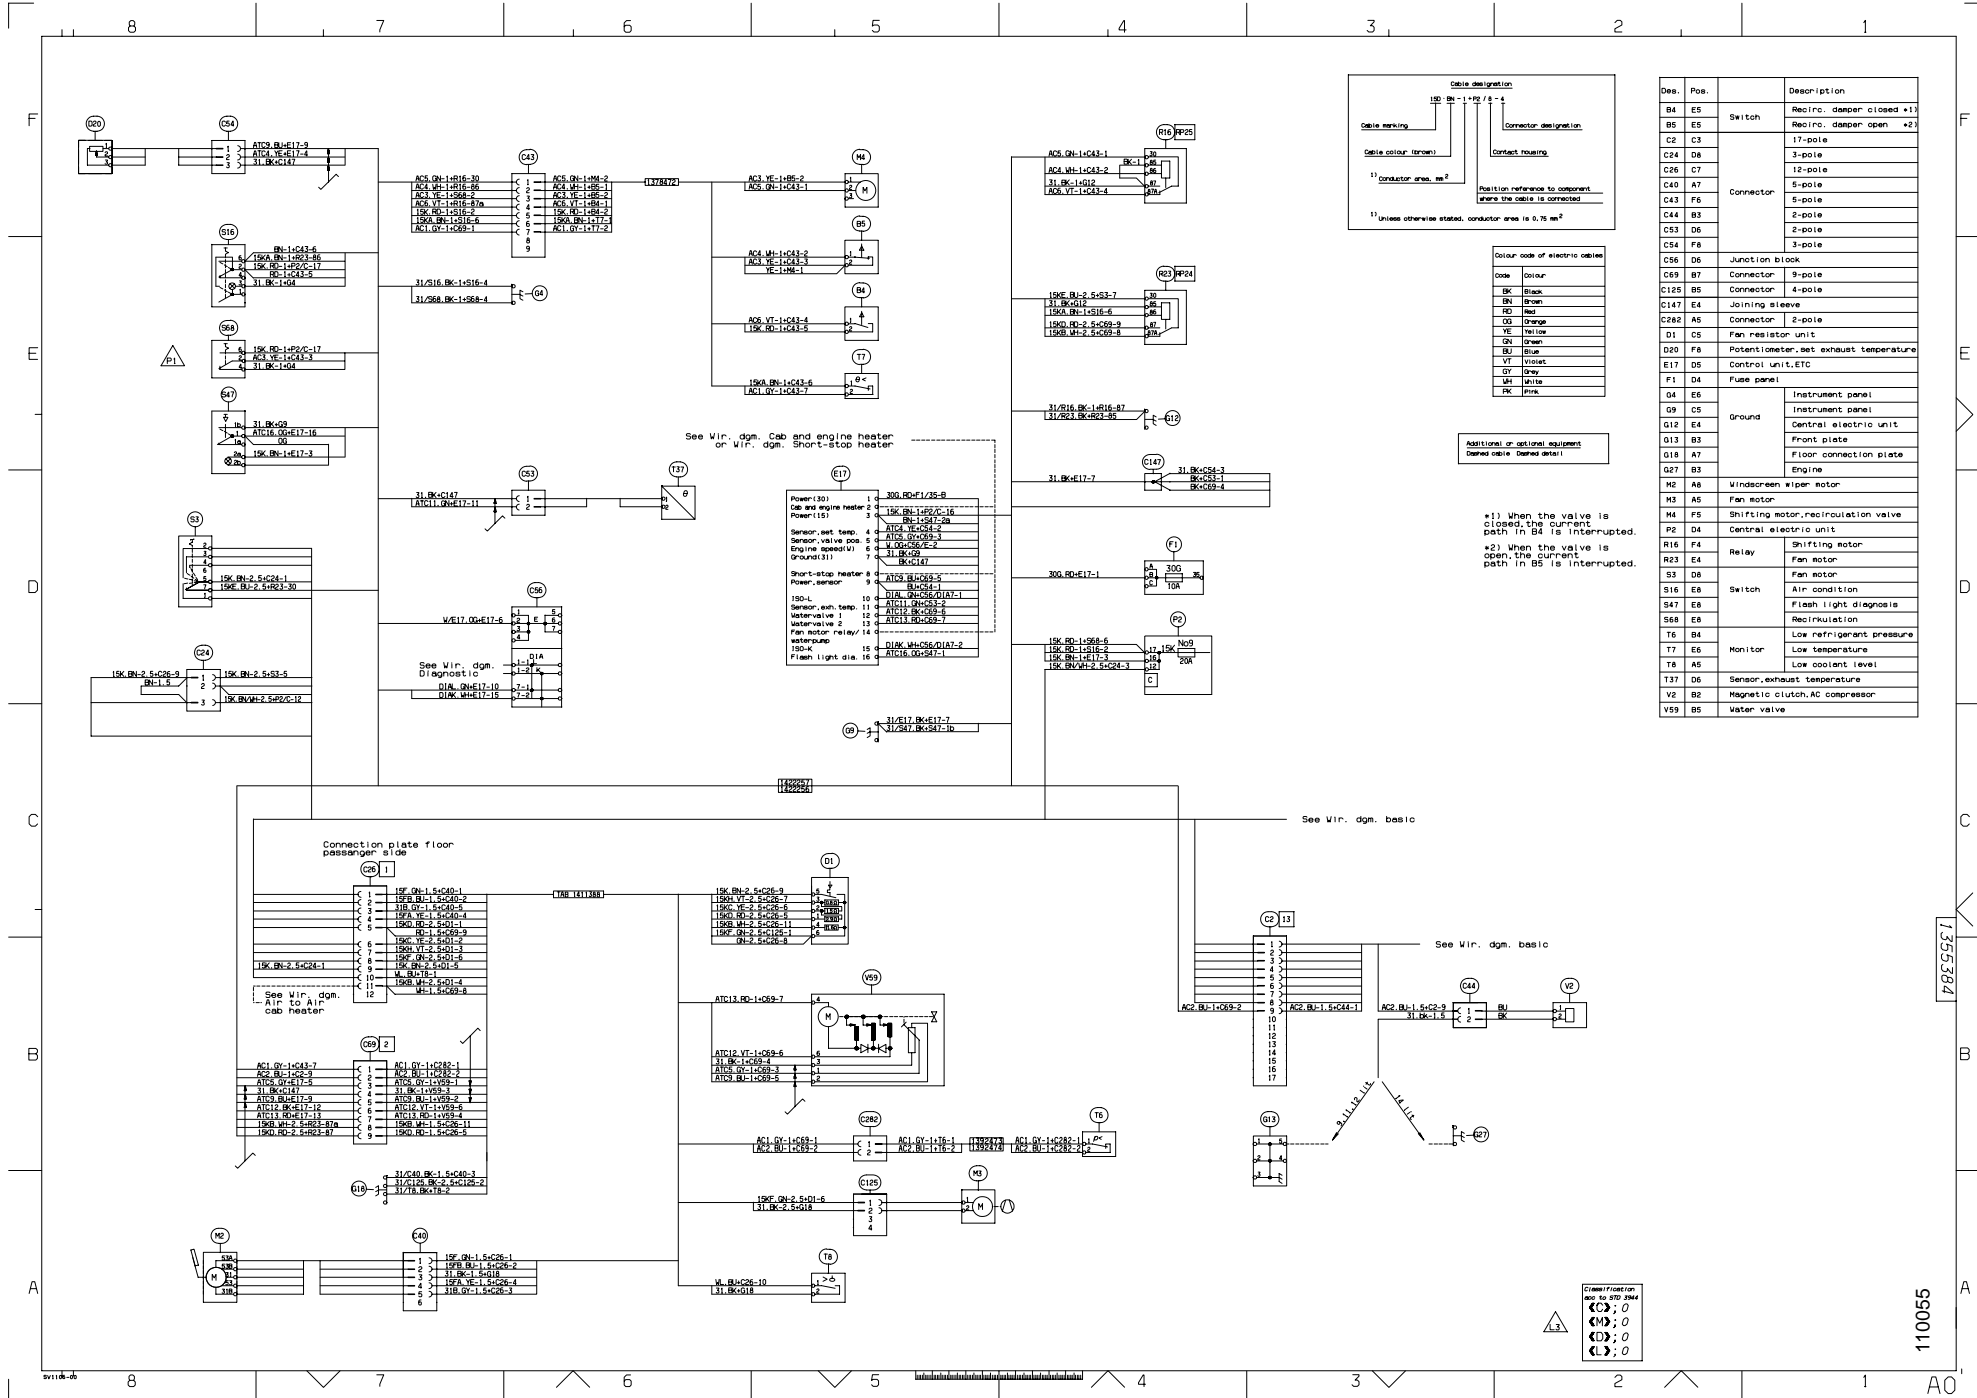

Colour code of electric cables

Code	Colour
BK	Black
BN	Brown
RD	Red
OR	Orange
YE	Yellow
GN	Green
BL	Blue
VT	Violet
GR	Grey
WH	White
PK	Pink

Additional or optional equipment
Denote cable. Define detail

¹⁾ When the valve is closed, the current path in B4 is interrupted.
²⁾ When the valve is open, the current path in B5 is interrupted.

Des.	Pos.	Description
B4	E5	Switch
B5	E5	Recirc. damper closed *1)
C2	C3	17-pole
C24	D8	3-pole
C26	C7	12-pole
C40	A7	5-pole
C43	F6	5-pole
C44	B3	2-pole
C53	D6	2-pole
C54	F6	3-pole
C56	D6	Junction block
C69	B7	Connector
C125	B5	Connector
C147	E4	Joining sleeve
C282	A5	Connector
D1	C5	Fan resistor unit
D20	F8	Potentiometer, set exhaust temperature
E17	D5	Control unit, ETC
F1	D4	Fuse panel
G4	E5	Instrument panel
G9	C6	Instrument panel
G12	B3	Central electric unit
G18	A7	Floor connection plate
G27	B3	Engine
H2	A6	Windscreen wiper motor
H3	A5	Fan motor
H4	F5	Shifting motor, recirculation valve
P2	D4	Central electric unit
R16	F4	Shifting motor
R23	E4	Fan motor
S3	D8	Fan motor
S16	E6	Switch
S47	E6	Flash light diagnosis
S68	E6	Recirculation
T6	B4	Low refrigerant pressure
T7	E6	Low temperature
T8	A5	Low coolant level
T37	D6	Sensor, exhaust temperature
V2	B2	Magnetic clutch, AC compressor
V59	B5	Water valve

110055

cardiagn.com

1355384

Confirmation
see p. 970 394
<C> : 0
<M> : 0
<D> : 0
<L> : 0